

MUNOZ INSPECTION SERVICES / TRUSTED TERMITE CONTROL

2098187308

munoztony197@gmail.com https://www.trustedtermitecontrol.services



PUT YOUR MIND AT EASE.



JUNE 20, 2022



Inspector
Anthony Munoz
Nachi20081131
2098187308
munoztony197@gmail.com

TABLE OF CONTENTS

1: General	5
2: Grounds	6
3: Roof	10
4: Exterior & Foundation	14
5: Plumbing / Fuel Systems	19
6: Heating, Ventilation and Air Condition (HVAC)	22
7: Basement	27
8: Garage or Carport	28
9: Electric	30
10: Water Heater	38
11: Fireplaces, Stoves	42
12: Bathroom & Laundry	43
13: Kitchen	48
14: Interior, Doors and Windows	56
15: Attic & Roof Structure	63
16: Crawl Space	65
Standard of Practice	68





SUMMARY





- 1.1.1 General Potential Concerns: Mold
- 2.2.1 Grounds Driveway: Driveways Minor
- 2.3.1 Grounds Sidewalks / Patios: Minor
- 3.1.1 Roof General: Needs repair
- 3.4.1 Roof Gutters / Downspouts / Extensions: Debris
- 3.4.2 Roof Gutters / Downspouts / Extensions: Damage
- 4.1.1 Exterior & Foundation Exterior Walls / Trim: Repair or Replace Stucco
- 4.1.2 Exterior & Foundation Exterior Walls / Trim: Minor exterior stucco cracks.
- 5.2.1 Plumbing / Fuel Systems Service / Main Line: Main shut-off In soil

- 5.2.2 Plumbing / Fuel Systems Service / Main Line: Main plumbing water line not properly fasten, secured.
- 8.8.1 Garage or Carport Garage-house steps: Steps
- △ 9.3.1 Electric Wiring: Splices not in box
- ♠ 9.5.1 Electric Receptacles: Loose
- ♠ 9.5.2 Electric Receptacles: No power
- △ 9.5.3 Electric Receptacles: Open ground Rewire or replace with 2-slot
- △ 9.8.1 Electric Smoke and CO alarms: Missing Smoke Alarm
- ⚠ 9.8.2 Electric Smoke and CO alarms: Inoperable co alarm/smoke dector

- 10.1.1 Water Heater General: Gurgling water heater, this can be a sign of the life expectancy of the water heater coming to an end. And or water heater needs to be flushed out and refilled with fresh water.
- ▲ 10.6.1 Water Heater TPR drain valve/line: Terminates too high above grade
- 10.8.1 Water Heater Flues: Missing fasteners
- 10.8.2 Water Heater Flues: Missing vent Flange to water heater flue.
- 12.3.1 Bathroom & Laundry Floors: Vinyl
- 12.3.2 Bathroom & Laundry Floors: Soft spongy floor possible water damage.
- 12.5.1 Bathroom & Laundry Toilets: Loose, eval, repair
- 13.3.1 Kitchen Floors: Worn damaged vinyl floor





- 13.6.1 Kitchen Dishwasher: No air gap
- 13.6.2 Kitchen Dishwasher: Dishwasher door very noisy when opening and closing
- 13.8.1 Kitchen Ventilation: Hood Light Inoperable / or missing light cover
- 14.1.1 Interior, Doors and Windows Exterior Doors: Wouldn't latch
- 14.3.1 Interior, Doors and Windows Windows & Skylights: Screens damaged, deteriorated
- Θ
- 14.3.2 Interior, Doors and Windows Windows & Skylights: One or more windows were difficult to operate
- 14.4.1 Interior, Doors and Windows Walls, Ceilings and Fixtures: Minor cracks, nail pops
- 14.4.2 Interior, Doors and Windows Walls, Ceilings and Fixtures: Patch to the walls and or ceilings.
- 16.1.1 Crawl Space General: Excessive moisture, Caused by heater condensate line leaking into the crawlspace.
- Θ
- 16.3.1 Crawl Space Floor Substructure: Surface fungus was observed at time of inspection to the subflooring.

1: GENERAL

Information

Potential Concerns: A home inspection is not a code compliance inspection, it is a visual inspection only there is no pass or fail.

Recommendations

1.1.1 Potential Concerns



Safety Hazard/Immediate concerns

MOLD

UTILITY ROOM

Microbial growths were found at one or more locations in *interior rooms / the attic / the crawl space / the basement / the garage*. It is beyond the scope of this inspection to identify what substance or organism this staining is. However such staining is normally caused by excessively moist conditions, which in turn can be caused by plumbing or building envelope leaks and/or substandard ventilation. These conducive conditions should be corrected before making any attempts to remove or correct the staining. Normally affected materials such as drywall are removed, enclosed affected spaces are allowed to dry thoroughly, a mildewcide may be applied, and only then is drywall reinstalled. For evaluation and possible mitigation, consult with a qualified industrial hygienist or mold/moisture mitigation specialist. For more information, visit:

Mold CDC Mold EPA

Recommendation



2: GROUNDS

Information

Soils / Drainage / Landscaping: Site Profile

Sidewalks / Patios: MaterialPoured in place concrete



Stairs : ConditionAppeared serviceable

Handrails: Materials

None

Driveway: ConditionServiceable

Decks / Porches: ConditionAppeared serviceable

Sidewalks / Patios: ConditionAppeared Serviceable

Decks / Porches: MaterialConcrete

Stairs : Exterior stair materialConcrete

Gaurdrails: Condition

None

Handrails: Condition

None


Gaurdrails: Materials

None

Driveway: MaterialPoured in place concrete



Fence: Wood fence

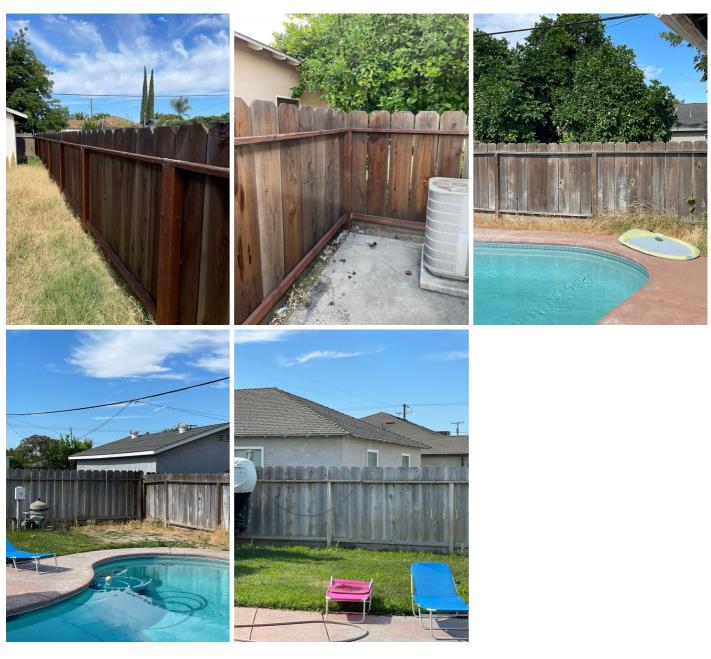

Recommendations

2.2.1 Driveway

DRIVEWAYS - MINOR



Minor deterioration (e.g. cracks, holes, settlement, heaving) was found in the driveway, but no trip hazards were found. The client may wish to have repairs made for cosmetic reasons.

Recommendation







2.3.1 Sidewalks / Patios

MINOR



Minor deterioration (e.g. cracks, holes, settlement, heaving) was found in sidewalks or patios, but no trip hazards were found. The client may wish to have repairs made for cosmetic reasons.

Recommendation



3: ROOF

Information

General: Method

Viewed from eaves on ladder

Shingles / Shakes: Layers

One

General: Condition

Appeared serviceable

Flashings: Condition of exposed

flashings

Appeared serviceable

General: Roof type

Gable

Gutters / Downspouts / Extensions: Condition

Appeared serviceable



Chimney & Flues: Condition

None

Chimney & Flues: Gas-fired flue type

None

Chimney & Flues: Wood-burning chimney type

None

General: Limitations

The following items or areas are not included in this inspection: areas that could not be traversed or viewed clearly due to lack of access; solar roofing components. Any comments made regarding these items are made as a courtesy only. Note that the inspector does not provide an estimate of remaining life on the roof surface material, nor guarantee that leaks have not occurred in the roof surface, skylights or roof penetrations in the past. Regarding roof leaks, only active leaks, visible evidence of possible sources of leaks, and evidence of past leaks observed during the inspection are reported on as part of this inspection. The inspector does not guarantee or warrant that leaks will not occur in the future. Complete access to all roof and attic spaces during all seasons and during prolonged periods of all types of weather conditions (e.g. high wind and rain, melting snow) would be needed to do so. Occupants should monitor the condition of roofing materials in the future. For older roofs, recommend that a professional inspect the roof surface, flashings, appurtenances, etc. annually and maintain/repair as might be required. If needed, the roofer should enter attic space(s). Regarding the roof drainage system, unless the inspection was conducted during and after prolonged periods of heavy rain, the inspector was unable to determine if gutters, downspouts and extensions perform adequately or are leak-free.



General: Roof surface material

Asphalt or fiberglass composition shingles







Limitations

Shingles / Shakes

RECOMMEND HAVING A QUALIFIED ROOFING COMPANY TO EVALUATE ROOF COVERING

Recommendations

3.1.1 General

NEEDS REPAIR




Roof covering showing signs of curling, cracking, loose, split Shingles, slipped tiles recommend a licensed roofing contractor to further evaluate roof covering.

Recommendation





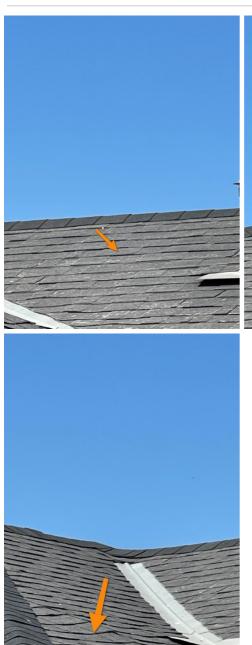





3.4.1 Gutters / Downspouts / Extensions

DEBRIS

Recommend Cleaning out the gutters Recommendation Contact a qualified professional.





3.4.2 Gutters / Downspouts / Extensions



DAMAGE

Parts of the gutter system or downspouts were damaged or dented and corroded. Recommend contacting a proper trades person to further evaluate and replace gutters as found to be necessary.

Recommendation



4: EXTERIOR & FOUNDATION

Information

Exterior Walls / Trim: Inspection

method

Viewed from ground

Foundation: MaterialPoured in place concrete

Exterior Walls / Trim: Wall cover

condition

Appeared serviceable

Foundation: Type
Crawl space

Exterior Walls / Trim: Wall

structure

Wood frame

Foundation: Footing material

Poured in place concrete

Limitations

The inspector performs a visual inspection of accessible components or systems at the exterior. Items excluded from this inspection include below-grade foundation walls and footings; foundations, exterior surfaces, common walls, or components obscured by vegetation, stored items or debris; wall structures obscured by coverings such as siding or trim. Some items such as siding, trim, soffits, vents and windows are often high off the ground, and may be viewed using binoculars from the ground or from a ladder. This may limit a full evaluation. Regarding foundations, some amount of cracking is normal in concrete slabs and foundation walls due to shrinkage and drying. Note that the inspector does not determine the adequacy of seismic reinforcement.

Exterior Walls / Trim: Wall Cover



Foundation: ConditionAppeared serviceable









Recommendations

4.1.1 Exterior Walls / Trim

REPAIR OR REPLACE STUCCO



Cracks, deterioration and/or damage were found in one or more areas of the exterior stucco finish. In damp climates, moisture can enter cracks or damaged areas and further deteriorate the stucco. Also the wall behind the stucco can become damaged from moisture. Note that areas behind the stucco are inaccessible and excluded from this inspection. Recommend that a qualified contractor repair or replace stucco as necessary.

Recommendation






4.1.2 Exterior Walls / Trim

MINOR EXTERIOR STUCCO CRACKS.



Stucco cracks occur when house settles and or stucco cures this is no more than a cosmetic issue recommend to sill stucco cracks with caulking and or exterior paint.

Recommendation

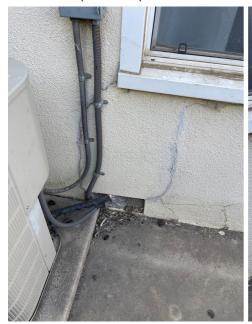







5: PLUMBING / FUEL SYSTEMS

Information

Service / Main Line: Condition

Unknown

Service / Main Line: Main shut-off Service / Main Line: Type

location

Public Building exterior

Service / Main Line: Water

Pressure PSI

70

Supply Lines: Condition

Appeared serviceable

Supply Lines: Type Galvanized steel

condition

Appeared serviceable

Drain and Waste Lines: Drain pipe Drain and Waste Lines: Waste pipe condition

Appeared serviceable

Drain and Waste Lines: Drain pipe

material

Cast iron, Galvanized steel

Drain and Waste Lines: Waste

pipe material Galvanized steel **Drain and Waste Lines:**

Recommend having a licensed plumbing company to further evaluate plumbing material and

its functionality.

Venting: Condition Appeared serviceable

Venting: Vent pipe material

Not visible

Sump Pump: Condition

None

Sump Pump: Sump pump

installed

Nο

Sewage Ejector Pump: Condition

None

Sewage Ejector Pump: Sewage

ejector pump installed

No

Irrigation: # of Zones

Not inspected

Irrigation: Irrigation system

Public

Fuel Systems: Condition

Appeared serviceable

Fuel Systems: Location of main

fuel shut-off At gas meter



Fuel Systems: Visible fuel storage

systems

Above ground



General: Limitations

The following items are not included in this inspection: private/shared wells and related equipment; private sewage disposal systems; hot tubs or spas; main, side and lateral sewer lines; gray water systems; pressure boosting systems; trap primers; incinerating or composting toilets; fire suppression systems; water softeners, conditioners or filtering systems; plumbing components concealed within the foundation or building structure, or in inaccessible areas such as below tubs; underground utilities and systems; overflow drains for tubs and sinks; backflow prevention devices. Any comments made regarding these items are as a courtesy only. Note that the inspector does not operate water supply or shut-off valves due to the possibility of valves leaking or breaking when operated. The inspector does not test for lead in the water supply, the water pipes or solder, does not determine if plumbing and fuel lines are adequately sized, and does not determine the existence or condition of underground or above-ground fuel tanks.

Recommendations

5.2.1 Service / Main Line

MAIN SHUT-OFF IN SOIL



The main water shut-off valve was in contact with soil. Corrosion or rust can occur as a result. Recommend removing or grading soil, or making modifications as necessary so the valve is not in contact with soil.

Recommendation

Recommended DIY Project





5.2.2 Service / Main Line



MAIN PLUMBING WATER LINE NOT PROPERLY FASTEN, SECURED.

Contact the proper trades person for the evaluate Water main line and secure Properly.

Recommendation



6: HEATING, VENTILATION AND AIR CONDITION (HVAC)

Information

General: Recommend a HVAC company to further evaluate heating and air-conditioning unit, Furnace heating and coolings units can fail at anytime.

Heating: Distribution TypeDucts and registers

Heating: Heating TypeForced air, Split system



Electric Heat (not forced air):
Condition
None

Forced Air: Fuel Type
Natural gas



Electric Heat (not forced air): Type None

Forced Air: LocationAttic

Forced Air: ConditionAppeared serviceable

Forced Air: BTU's Adequate?
Yes

Filters: Condition

Recommend replacing upon taking occupancy

Ducts & Registers: ConditionAppeared serviceable

Flues: ConditionAppeared serviceable

Filters: Filter locationHallway

Burners (furnace or boiler): Condition Recommend servicing

Heat Pump; AC: ConditionAppeared serviceable

Filters: Size Unknown

Combustion Air: TypeIntake duct

Heat Pump; AC: LocationBuilding exterior



Normal Controls: Condition
Appeared serviceable

Heat Pump; AC: Air conditioning unit worked and was functional at time of inspection



Heat Pump; AC: Recommend a licenced HVAC Company to further evaluate Air Conditioning unit.

General: Limitations

The following items are not included in this inspection: humidifiers, dehumidifiers, electronic air filters; solar, coal or wood-fired heat systems; thermostat or temperature control accuracy and timed functions; heating components concealed within the building structure or in inaccessible areas; underground utilities and systems; safety devices and controls (due to a utomatic operation). Any comments made regarding these items are as a courtesy only. Not e that the inspector does not provide an estimate of remaining life on heating or cooling system components, does not determine if heating or cooling systems are appropriately sized, does not test coolant pressure, or perform any evaluations that require a pilot light to be lit, a shut-off valve to be operated, a circuit breaker to be turned "on" or a serviceman's or oil e mergency switch to be operated. It is beyond the scope of this inspection to determine if fur nace heat exchangers are intact and free of leaks. Condensation pans and drain lines may clog or leak at any time and should be monitored while in operation in the future. Where buil dings contain furnishings or stored items, the inspector may not be able to verify that a heat source is present in all "liveable" rooms (e.g. bedrooms, kitchens and living/dining rooms).

Forced Air: Heater/Furnace was functioning properly at time of inspection.

Recommend having a qualified heating and air conditioning company to perform an additional inspection on the Heating unit. At any time the heater/Furnace can malfunction.





Heat Pump; AC: Cooling fuel type

Electric







Heat Pump; AC: Type

Split system









7: BASEMENT

Information

Floor Substructure: Beam

material None

Floor Substructure: Floor

structure None

Floor Insulation: Insulation

material

Not determined

iateriai

Floor Substructure: Concrete slab Floor Substructure: Condition

condition None

None

Floor Substructure: Pier/support Floor Insulation: Condition

post material None

None

General: Limitations

Structural components such as joists and beams, and other components such as piping, wiring and/or ducting that are obscured by under-floor insulation are also excluded from this inspection. Note that the inspector does not determine if support posts, columns, beams, joists, studs, trusses, etc. are of adequate size, spanning or spacing.

The inspector does not guarantee or warrant that water will not accumulate in the basement in the future. Access to the basement during all seasons and during prolonged periods of all types of weather conditions (e.g. heavy rain, melting snow) would be needed to do so. The inspector does not determine the adequacy of basement floor or stairwell drains, or determine if such drains are clear or clogged.

Note that all basement areas should be checked periodically for water intrusion, plumbing leaks and pest activity.

8: GARAGE OR CARPORT

Information

General: TypeAttached

Vehicle Door: Condition

None

Automatic Opener: Condition

None

Attached Garage-House Door:

ConditionNone

Vehicle Door: Type

None

Automatic Opener: Mechanical

auto-reverse operable

None

Attached Garage-House Door:

TypeNone

Vehicle Door: # of Doors

None

Floor: Condition
Obstructed



Interior/Walls/Ceilings: Condition Interior/Walls/Ceilings:

Serviceable Ventilation
Window

General: Limitations

The inspector does not determine the adequacy of firewall ratings. Requirements for ventilation in garages vary between municipalities.

Limitations

General

GARAGE WAS CONVERTED INTO A LIVING QUARTERS.



Recommendations

8.8.1 Garage-house steps

Deficiencies

STEPS

The step(s) installed below the door between the garage and the house were *loose / damaged / deteriorated / substandard*. This is a fall or trip hazard. A qualified person should repair as necessary.

Recommendation







9: ELECTRIC

Information

consider a License electrician to further evaluate main & subpanels for more depth information on the electrical.have The license electrician take off dead front covers at inspect breakers and wiring.

Service: ConditionAppeared serviceable

Service: TypeOverhead



Service: Voltage 120-240

Service: Max Amperage 200

Service: ProtectionBreakers








Panels: Sub-panel(s) condition
Appeared serviceable, Have a
qualified licensed electrician to
further evaluate all electrical
panels.

Service: Service entrance conductor material

Not determined



Panels: Location of MAIN panel #A
Building exterior

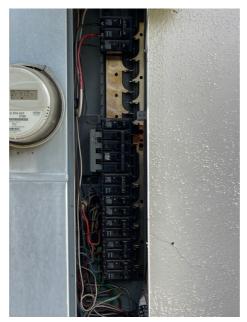

Service: Main disconnect rating 200



Panels: Location of MAIN panel #B

None

Panels: Location of MAIN panel #C None



Middle of the service panel



Wiring: Solid strand aluminum wiring present

None visible

Wiring: Condition
Serviceable

Receptacles: GFCI presentYes

Smoke and CO alarms: CO alarms installed
Yes



Smoke and CO alarms: Smoke alarms installed

No recommend install

Limitations

The following items are not included in this inspection: generator systems, transfer switches, surge suppressors, inaccessible or concealed wiring; underground utilities and systems; low-voltage lighting or lighting on timers or sensors. Any comments made regarding these items are as a courtesy only. Note that the inspector does not determine the adequacy of grounding or bonding, if this system has an adequate capacity for the client's specific or anticipated needs, or if this system has any reserve capacity for additions or expansion. The inspector does not operate circuit breakers as part of the inspection, and does not install or change light bulbs. The inspector does not evaluate every wall switch or receptacle, but instead tests a representative number of them per various standards of practice. When furnishings, stored items or child-protective caps are present some receptacles are usually inaccessible and are not tested; these are excluded from this inspection. Receptacles that are not of standard 110 volt configuration, including 240-volt dryer receptacles, are not tested and are excluded. The functionality of, power source for and placement of smoke and carbon monoxide alarms is not determined as part of this inspection. Upon taking occupancy, proper operating and placement of smoke and carbon monoxide alarms should be verified and batteries should be changed. These devices have a limited lifespan and should be replaced every 10 years. The inspector attempts to locate and evaluate all main and sub-panels. However, panels are often concealed. If panels are found after the inspection, a qualified electrician should evaluate and repair if necessary. The inspector attempts to determine the overall electrical service size, but such estimates are not guaranteed because the overall capacity may be diminished by lesser-rated components in the system, Inspector does not remove electrical panel covers if panel covers are removed it is as a

Courtesy. Any repairs recommended should be made by a licensed electrician.

Panels: Main service panel condition

Appeared serviceable, Consult a licensed electrician to further evaluate electrical panel





Wiring: Branch circuit wiring type

Copper









Recommendations

9.3.1 Wiring

SPLICES NOT IN BOX

ATTIC



Wire splices were exposed and were not contained in a covered junction box or fixture. This is a potential shock or fire hazard. Recommend that a qualified electrician repair per standard building practices. For example, by installing permanently mounted junction boxes with cover plates where needed to contain wiring splices.

Recommendation

Contact a qualified electrical contractor.





9.5.1 Receptacles

LOOSE

UTILITY ROOM

One or more electric receptacles and/or the boxes in which they were installed were loose and/or not securely anchored. Wire conductors can be damaged due to repeated movement and/or tension on wires, or insulation can be damaged. This is a shock and fire hazard. Recommend that a qualified electrician repair as necessary.

Recommendation

Contact a qualified electrical contractor.



9.5.2 Receptacles

NO POWER

EXTERIOR, UTILITY ROOM

One or more electric receptacles appeared to have no power. Recommend asking the property owner about this. Switches may need to be operated or GFCI/AFCI protection may need to be reset to make some receptacles energized. If necessary, recommend that a qualified electrician evaluate and repair.

Recommendation

Contact a qualified electrical contractor.











9.5.3 Receptacles

Safety Hazard/Immediate concerns

OPEN GROUND - REWIRE OR REPLACE WITH 2-SLOT

UTILITY ROOM

One or more modern, 3-slot electric receptacles were found with an open ground. Three-slot receptacles should have a hot, a neutral and a ground wire connected. Homeowners often install new 3-slot receptacles on older, 2-wire circuits that only have hot and neutral wires. This is a shock hazard when appliances that require a ground are used with these receptacles. Examples of such appliances include computers and related hardware, refrigerators, freezers, portable air conditioners, clothes washers, aquarium pumps, and electrically operated gardening tools. Where the electric system was installed prior to when grounded circuits were required (1960s), it is permissible to replace 3-slot receptacles with 2-slot receptacles to prevent appliances that require a ground from being plugged in to an ungrounded circuit. However, the client should be aware of this limitation when planning use for various rooms, such as an office. For newer electric systems, circuits should be repaired so grounded, 3-wire cables provide power to 3-slot receptacles. Recommend that a qualified electrician repair per standard building practices.




Recommendation

Contact a qualified electrical contractor.

9.8.1 Smoke and CO alarms

MISSING - SMOKE ALARM

ALL BEDROOMS

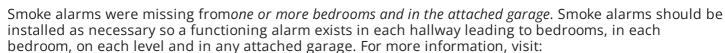


SMKALRM

Recommendation

Recommended DIY Project

Safety Hazard/Immediate concerns

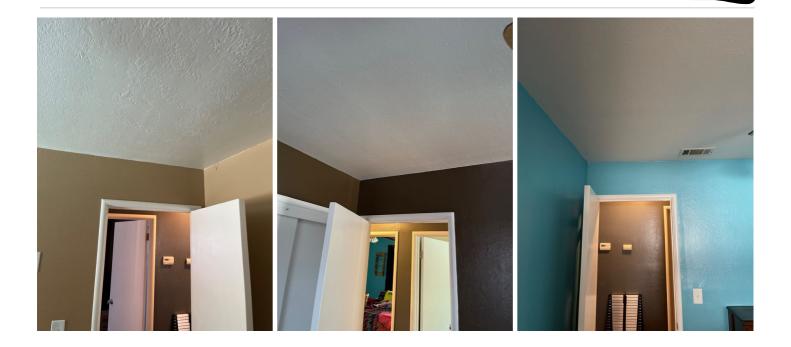

9.8.2 Smoke and CO alarms

Safety Hazard/Immediate concerns

INOPERABLE CO ALARM/SMOKE DECTOR

Install proper Co detector/ smoke alarm as necessary.

Recommendation



10: WATER HEATER

Information

General: ConditionAppeared serviceable

General: Energy sourceNatural gas




General: LocationUtility room

General: TypeTank



General: TPR valveYes

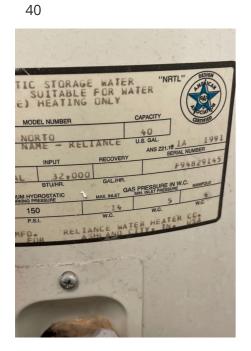

General: Capacity





Seismic straps: Seismic straps



Burners: ConditionAppeared serviceable





Flues: ConditionAppeared Serviceable



General: Limitations

Evaluation of and determining the adequacy or completeness of the following items are not included in this inspection: water recirculation pumps; solar water heating systems; Energy Smart or energy saver controls; catch pan drains. Any comments made regarding these items are as a courtesy only. Note that the inspector does not provide an estimate of remaining life on water heaters, does not determine if water heaters are appropriately sized, or perform any evaluations that require a pilot light to be lit or a shut-off valve to be operated.

Recommendations

10.1.1 General

GURGLING WATER HEATER, THIS CAN BE
A SIGN OF THE LIFE EXPECTANCY OF THE WATER
HEATER COMING TO AN END. AND OR WATER HEATER
NEEDS TO BE FLUSHED OUT AND REFILLED WITH FRESH
WATER.



Contact proper tradesperson to further evaluate and correct or replace as necessary.


Recommendation

Contact a qualified professional.



10.6.1 TPR drain valve/line

TERMINATES TOO HIGH ABOVE GRADE

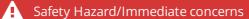

The temperature-pressure relief valve drain line terminated too high above the ground. Someone standing next to the drain line could be scalded if the valve opens. Recommend that a qualified person repair per standard building practices. For example by extending the drain line. For more information, visit:

TPRVALVE

Recommendation

Contact a qualified professional.



10.8.1 Flues

MISSING FASTENERS



Water heater flue pipe needs to be properly fastened with metal screws and all joints should be wrapt with temperature rated tape.

Recommendation



10.8.2 Flues

MISSING VENT FLANGE TO WATER HEATER FLUE.

Safety Hazard/Immediate concerns

Recommend installing vent flange to water heater, this is considered a safety concern.

Vent flue is in direct contact with combustible material.

Recommendation



11: FIREPLACES, STOVES

Information

Wood-burning fireplace, stove:

Condition

None

Gas-fired fireplace, stove, or log

lighter: Condition

None

Wood-burning fireplace, stove: Wood-burning fireplace type

None

Gas-fired fireplace, stove, or log

lighter: Gas Type

None

Wood-burning fireplace, stove:

Wood-burning stove type

Freestanding

Limitations

General

FIREPLACE INSERTS/FREE STANDING WOOD BURNING FIRE PLACE IS OUT OF THE SCOPE OF THE HOME INSPECTION. CONTACT A PROPER TRADES TO EVALUATE UNITS.

12: BATHROOM & LAUNDRY

Information

Location

1st Floor

Counters: ConditionAppeared serviceable



Floors: Condition
Appeared serviceable

Floors: Type or coveringVinyl linoleum or marmoleum

Sinks: ConditionAppeared serviceable



Laundry: 240 present Yes

Toilets: ConditionAppeared serviceable



Laundry: Gas supply for laundry equipment present
No

Ventilation: ConditionAppeared serviceable

Limitations

The following items are not included in this inspection: overflow drains for tubs and sinks; heated towel racks, saunas, steam generators, clothes washers, clothes dryers. Any comments made regarding these items are as a courtesy only. Note that the inspector does not determine the adequacy of washing machine drain lines, washing machine catch pan drain lines, or clothes dryer exhaust ducts. The inspector does not operate water supply or shut-off valves for sinks, toilets, bidets, clothes washers, etc. due to the possibility of valves leaking or breaking when operated. The inspector does not determine if shower pans or tub and shower enclosures are water tight, or determine the completeness or operability of any gas piping to laundry appliances.

Cabinets: ConditionAppeared serviceable






Bathtubs: ConditionAppeared serviceable







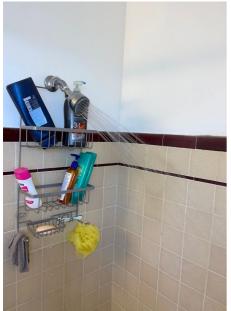





Ventilation: Bathroom and laundry ventilation typeWindows, Spot exhaust fans





Recommendations

12.3.1 Floors

VINYL



Vinyl flooring in bathroom was damaged / deteriorated / loose / curling. Water can damage the the sub-floor as a result. Recommend that a qualified contractor replace or repair flooring as necessary.



Recommendation

Contact a qualified professional.



12.3.2 Floors

SOFT SPONGY FLOOR POSSIBLE WATER DAMAGE.

See termite inspection report for any recommendations

Recommendation

Contact a qualified professional.



12.5.1 Toilets

LOOSE, EVAL, REPAIR





The toilet was loose where it attached to the floor. Leaks can occur. Flooring, the sub-floor or areas below may get damaged. Sewer gases can enter living spaces. Recommend that a qualified contractor remove the toilet(s) for further evaluation and repair if necessary. A new wax ring should be installed and toilet(s) should be securely anchored to the floor to prevent movement and leaking.

Recommendation

Contact a qualified professional.



13: KITCHEN

Information

Counters: ConditionAppeared serviceable

Floors: ConditionAppeared serviceable

Sinks: ConditionAppeared serviceable



Under-Sink Food Disposal: ConditionAppeared Serviceable




Dishwasher: ConditionAppeared serviceable

Range/Cooktop/Oven: Fuel Type
Electric



Refrigerator: ConditionNot inspected

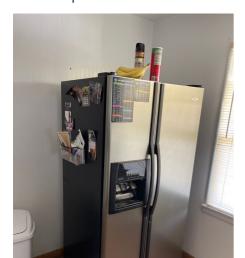

Microwave: Condition
None

Limitations

The following items are not included in this inspection: household appliances such as stove s, ovens, cook tops, ranges, warming ovens, griddles, broilers, dishwashers, trash compacto rs, refrigerators, freezers, ice makers, hot water dispensers and water filters; appliance time rs, clocks, cook functions, self and/or continuous cleaning operations, thermostat or tempe rature control accuracy, and lights. Any comments made regarding these items are as a courtesy only. Note that the inspector does not provide an estimate of the remaining life of appliances, and does not determine the adequacy of operation of appliances. The inspector does not note appliance manufacturers, models or serial numbers and does not determine if appliances are subject to recalls. Areas and components behind and obscured by appliance s are inaccessible and excluded from this inspection.

Counters: MaterialTile, Formica





Cabinets: ConditionAppeared serviceable











Floors: Type or covering
Vinyl linoleum or marmoleum



Range/Cooktop/Oven: Condition
Appeared serviceable





Hood



Limitations

Counters

KITCHEN COUNTER NOT FULLY INSPECTED DO TO OWNERS STORAGE







Recommendations

13.3.1 Floors

WORN DAMAGED VINYL FLOOR




Contact proper trades person to further evaluate and repair or replace as necessary and if desired.

Recommendation



13.6.1 Dishwasher

NO AIR GAP

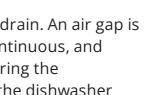

No air gap was visible for the dishwasher drain. An air gap is a device that makes the drain line non-continuous, and prevents waste-water backflow from entering the dishwasher, and possibly flooding out of the dishwasher if/when a siphon occurs. Some newer dishwashers have this device built in. Recommend determining if an air gap device is built in to this brand and model of dishwasher (e.g. review installation instructions). If not, or if this cannot be determined, then recommend that a qualified contractor install an air gap per standard building practices.



Recommendation

Contact a qualified professional.

13.6.2 Dishwasher

DISHWASHER DOOR VERY NOISY WHEN OPENING AND CLOSING



Contact a proper trades person to further evaluate dishwasher door and lubricate springs or hinges as necessary.

Recommendation



13.8.1 Ventilation

HOOD LIGHT - INOPERABLE / OR MISSING LIGHT COVER



The light in the exhaust hood was inoperable / or light cover missing Recommend replacing light bulb(s) or light cover. that repairs be made by a qualified person if necessary.


Recommendation



14: INTERIOR, DOORS AND WINDOWS

Information

Walls, Ceilings and Fixtures: Walls/Ceilings

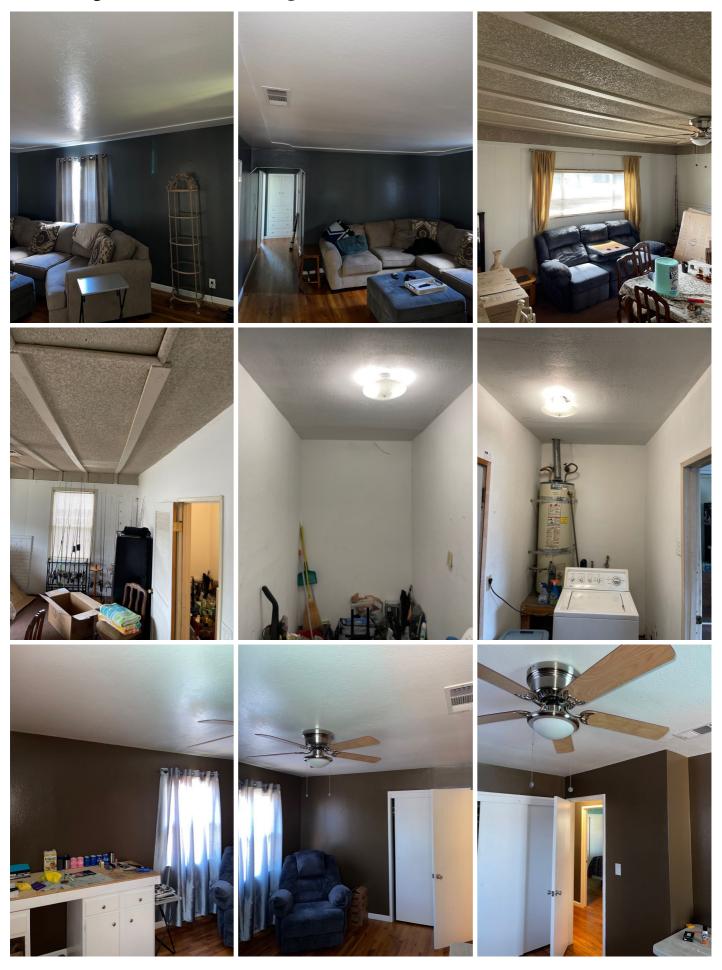




Limitations


Walls, Ceilings and Fixtures

WALLS/ FLOORS/ NOT FULLY VISIBLE DUE TO OWNER STORAGE/ BELONGINGS/ FLOOR COVERS.



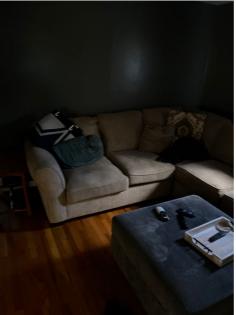



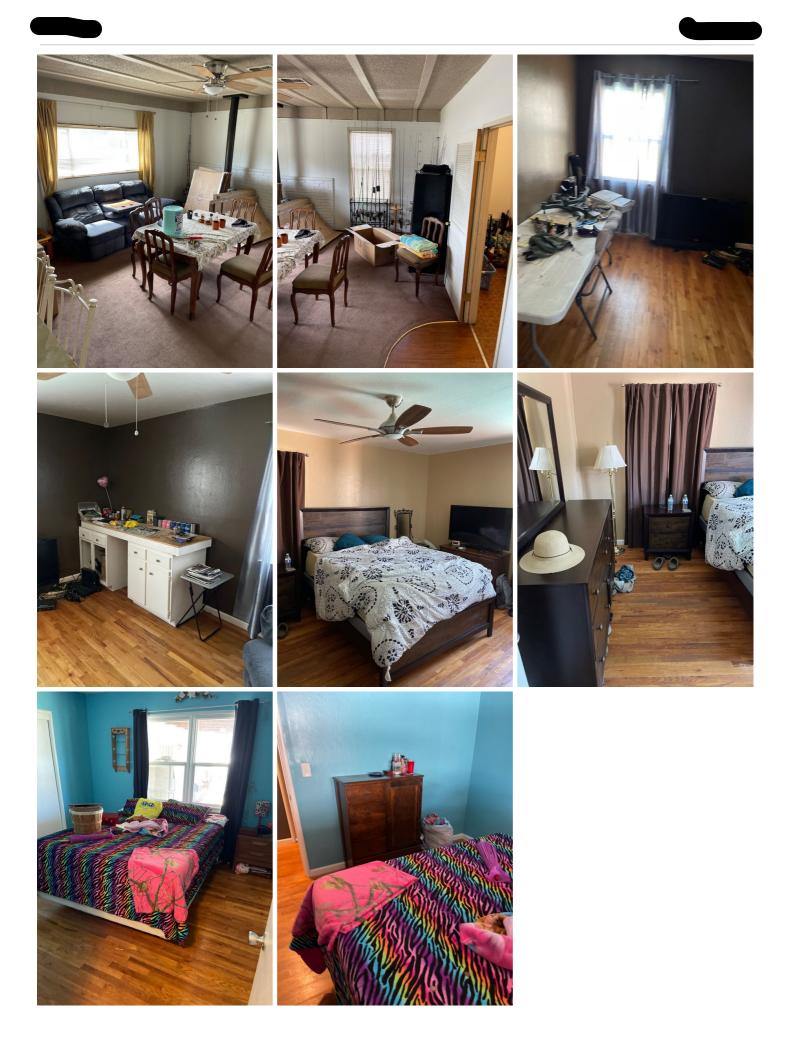

Recommendations

14.1.1 Exterior Doors


WOULDN'T LATCH



One or more entry doors wouldn't latch when closed. This is a security concern if no deadbolt is installed. A qualified person should repair as necessary.

Recommendation

Contact a handyman or DIY project

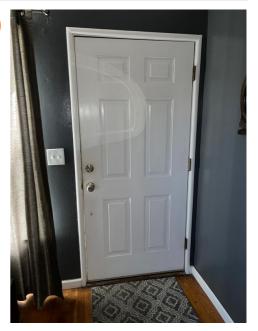

14.3.1 Windows & Skylights

SCREENS DAMAGED, DETERIORATED



One or more window screens were damaged or deteriorated. These window(s) may not provide ventilation during months when insects are active. Recommend replacing window screens as necessary.

Recommendation

Contact a handyman or DIY project





14.3.2 Windows & Skylights

ONE OR MORE WINDOWS WERE DIFFICULT TO OPERATE








Contact a proper trades company to further evaluate windows and there functionality, and repair or lubricate window tracks as needed.

Recommendation

Contact a qualified professional.

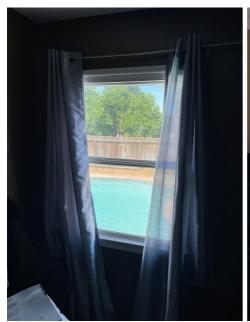





14.4.1 Walls, Ceilings and Fixtures

MINOR CRACKS, NAIL POPS



Minor cracks, nail pops and/or blemishes were found in walls and/or ceilings in one or more areas. Cracks and nail pops are common, are often caused by lumber shrinkage or minor settlement, and can be more or less noticeable depending on changes in humidity. They did not appear to be a structural concern, but the client may wish to repair these for aesthetic reasons. For recurring cracks, consider using an elastic crack covering product:

Recommendation

Contact a qualified handyman.



14.4.2 Walls, Ceilings and Fixtures



PATCH TO THE WALLS AND OR CEILINGS.

Recommend to ask Owner for any information regarding the patching to the ceiling and or walls.

Recommendation



15: ATTIC & ROOF STRUCTURE

Information

Access: Method
Viewed from Hatch

Insulation: Insulation conditionAppeared serviceable

Ventilation: ConditionAppeared serviceable

Roof Structure: ConditionAppeared serviceable

Insulation: RatingNot determined

Ventilation: TypesGable end vents

Roof Structure: Ceiling structure

Ceiling joists

Insulation: Vermiculite


None visible

Limitations

The following items or areas are not included in this inspection: areas that could not be traversed or viewed clearly due to lack of access; areas and components obscured by insulation. Any comments made regarding these items are made as a courtesy only. The inspector does not determine the adequacy of the attic ventilation system. Complete access to all roof and attic spaces during all seasons and during prolonged periods of all types of weather conditions (e.g. high/low temperatures, high/low humidity, high wind and rain, melting snow) would be needed to do so. The inspector is not a licensed engineer and does not determine the adequacy of roof structure components such as trusses, rafters or ceiling beams, or their spacing or sizing.

Roof Structure: Roof structure type

Rafters

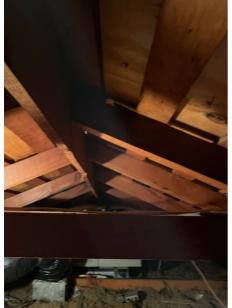





Insulation: TypeCellulose loose fill



16: CRAWL SPACE

Information

Access: Inspection method

Traversed

Floor Insulation: Condition

None

Vapor Barrier: Vapor barrier

present?

None visible

Floor Substructure: Beam

Material

Solid wood

Floor Insulation: Insulation

Material

None visible

Ventilation: Condition

Appeared serviceable

Floor Substructure: Condition

Appeared serviceable

Vapor Barrier: Condition

None

Ventilation: Type

with vents

General: Limitations

Structural components such as joists and beams, and other components such as piping, wiring and/or ducting that are obscured by under-floor insulation are excluded from this inspection. The inspector does not determine if support posts, columns, beams, joists, studs, trusses, etc. are of adequate size, spanning or spacing.

The inspector does not guarantee or warrant that water will not accumulate in the crawl spaces in the future. Complete access to all crawl space areas during all seasons and during prolonged periods of all types of weather conditions (e.g. heavy rain, melting snow) would be needed to do so.

The inspector attempts to locate all crawl space access points and areas. Access points may be obscured or otherwise hidden by furnishings or stored items. In such cases, the client should ask the property owner where all access points are that are not described in this inspection, and have those areas inspected. Note that crawl space areas should be checked at least annually for water intrusion, plumbing leaks and pest activity.

Floor Substructure: Pier or Post Material

Concrete block, Wood pier post





Floor Substructure: Floor structure

Solid wood joists



Recommendations

16.1.1 General

EXCESSIVE MOISTURE, CAUSED BY HEATER CONDENSATE LINE LEAKING INTO THE CRAWLSPACE.



Contact a proper trays person to further evaluate and redirect condensate line to the exterior of the home. Moisture can calls surface fungi and can attract subterranean termites.

Recommendation









16.3.1 Floor Substructure



SURFACE FUNGUS WAS OBSERVED AT TIME OF INSPECTION TO THE SUBFLOORING.

See termite inspection report for recommendations.

Recommendation





STANDARDS OF PRACTICE